
City of Baltimore Wet Smoke and Dyed	Page 1 of 2	
Sewershed: Gwynns Falls	Company: Savin	Date: 4/14/2009
Test to be performed: Smoke Dyed Water X	Ground Condition: Dry ✓ Damp □ Wet □	Supervisor: JAW
Manhole_ID: S04EE1021MH	Test ID: <u>D1032-028006</u>	Notification Made: NA (Residents, Fire, 311)

Field Sketch: Show all manholes with Numbers, Blower Placement Locations, Sandbag or Isolation Locations, Street Names, Building Addresses and Locations, Defect Locations and Photo Numbers.

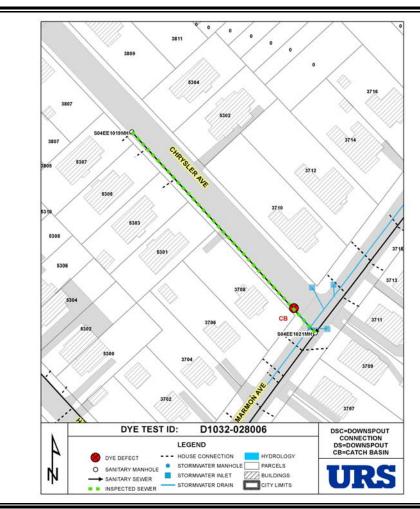

Defect Loc	Obs_ClockFrom	Obs_ClockTo	Observation	Obs_Remarks
0			Start of Survey	
0			Manhole	S04EE1021MH
0			Water Level	
11.69999981			Water Level Sag	
20.20000076			Dye Test Visible	@IR, 1/4 GPM
20.20000076	08		Infil Runner	@ jt
29.10000038			Dye Test Visible	@ IR, 1-1/2 GPM
29.10000038	02		Infil Runner	@jt
32.20000076			Dye Test Visible	@ IR, 1-1/2 GPM
32.20000076	10		Infil Runner	@ jt
35.40000153			Dye Test Visible	@ IR, 1/8 GPM

City of Baltimore We Smoke and Dye	Page 2 of 2	
Sewershed: Gwynns Falls	Company: Savin	Date: 4/14/2009
Test to be performed: Smoke Dyed Water X	Ground Condition: Dry ✓ Damp □ Wet □	Supervisor: JAW
Manhole_ID: S04EE1021MH	Test ID: <u>D1032-028006</u>	Notification Made: NA (Residents, Fire, 311)
35.40000153 02 36.59999847	Infil Runner @ jt Abandoned Survey NO MC	DRE DYE VISSIBLE